# OMRON

# Phase-sequence Phase-loss Relay K8AB-PH1

# Three-phase Phase-sequence Phase-loss Relay Using Voltage Detection Method

# Fixed phase Asymmetry monitoring <u>NEW</u>

- Prevents reverse motor rotation due to incorrect wiring.
- Distinguishes between positive phases, reversed phases, and phase loss when power is turned ON.
- Voltage detection method enables application for any load current.
- One SPDT output relay, 6 A at 250 VAC (resistive load).
- Output status can be monitored using LED indicator.

# Model Number Structure

### Model Number Legend

 $\frac{\mathbf{K8AB}}{1} \xrightarrow{2} 3$ 

- 1. Basic Model
- K8AB: Measuring and Monitoring Relays 2. Functions
  - PH: Phase-sequence Phase-loss Relay

# **Ordering Information**

### List of Models

Phase-sequence Phase-loss Relay	Functions	Rated input voltage *	Model
	Phase sequence and phase loss monitoring	200 to 500 VAC	K8AB-PH1

\* The power supply is shared with the rated input voltage.



3. Rated Input Voltage

1: 200 to 500 VAC

# K8AB-PH1

# **Ratings and Specifications**

# Ratings


Rated input voltage	Three-phase, three-wire mode, 200 to 500 VAC		
Input load	15 VA max.		
Reversed phase and phase loss operating time	0.1 s max.		
Reset method	Automatic reset		
Indicators	Power (PWR): Green, Relay output (RY): Yellow		
Output relays	One SPDT relay (NC operation)		
Output relay ratings	Rated load Resistive load $6 A at 250 VAC (cos\phi = 1)$ $6 A at 30 VDC (L/R = 0 ms)$ Inductive load $1 A at 250 VAC (cos\phi = 0.4)$ $1 A at 30 VDC (L/R = 7 ms)$ Maximum contact voltage: Maximum contact current: Maximum switching capacity: $1,500 VA$ Maximum load: Mechanical life:1,000,000 operations Electrical life:Make: 50,000 times, Break: 30,000 times		
Ambient operating temperature	-20 to 60°C (with no condensation or icing)		
Storage temperature	-40 to 70°C (with no condensation or icing)		
Ambient operating humidity	25% to 85% (with no condensation)		
Storage humidity	25% to 85% (with no condensation)		
Altitude	2,000 m max.		
Terminal screw tightening torque	0.54 N·m		
Terminal wiring method	Recommended wire      Solid wire:    2.5 mm²      Twisted wires:    AWG16, AWG18      Note:    1. Ferrules with insulating sleeves must be used with twisted wires.      2. Two wires can be twisted together.      Recommended ferrules      Al 1,5-8BK (for AWG16) manufactured by Phoenix Contact      Al 1-8RD (for AWG16) manufactured by Phoenix Contact      Al 0,75-8GY (for AWG18) manufactured by Phoenix Contact		
Case color	Munsell 5Y8/1		
Case material	ABS resin (self-extinguishing resin) UL94-V0		
Weight	Approx. 110 g		
Mounting	Mounted to DIN Track or via M4 screws (tightening torque: 1.2 N·m)		
Dimensions	22.5 (W) × 90 (H) × 100 (D) mm		

### **Specifications**

Input voltage range		200 to 500 VAC	
Input frequency range		45 to 65 Hz	
Overload capacity		Continuous input: 115% of maximum input, 10 s max.: 125% of maximum input	
Fixed Phase Asymmetry Monitoring		Output relay releases when one phase-phase voltage drops below 80% of the other phase-phase voltage.	
Temperature influence		Operating time Fluctuation based on measured value at standard temperature: -20°C to standard temperature: ±10% max. Standard temperature to 60°C: ±10% max. (Humidity: 25% to 80%)	
Humidity influ	ence	Operating time Based on ambient room humidity 25% to 80%: ±10% max.	
Influence of power supply voltage		Operating time: ±10% max. Note: The error in the operating value and operating time under standard conditions.	
Influence of power supply frequency		Operating time: ±10% max. (at 45 to 65 Hz) Note: The error in the operating value and operating time under standard conditions.	
Influence of input frequency		At 45 to 65 Hz Operating time: ±10% max. Note: The error in the operating value and operating time under standard conditions.	
Applicable standards	Conforming standards	EN60255-5 and EN60255-6 Installation environment (Pollution Degree 2, Overvoltage Category III)	
	EMC	EN61326	
	Safety standards	UL508	
Insulation resistance		20 MΩ min. Between external terminals and case Between input terminals and output terminals	
Dielectric strength		2,000 VAC for one minute Between external terminals and case Between input terminals and output terminals	
Noise immuni	ty	1,500 V power supply terminal common/normal mode Square-wave noise of $\pm 1 \ \mu s/100$ ns pulse width with 1-ns rise time	
Vibration resistance		Frequency 10 to 55 Hz, 0.35-mm single amplitude, acceleration 50 m/s <sup>2</sup> 10 sweeps of 5 min each in X, Y, and Z directions	
Shock resistance		100 m/s <sup>2</sup> , 3 times each in 6 directions along three axes (up/down, left/right, forward/backward)	
Degree of protection		Terminal section: Finger protection	


# Connections

### Wiring Diagram Phase Sequence and Phase Loss Operation Diagram



Note: 1. The K8AB-PH1 output relay is normally operative.


- 2. L1 and L3 function both as the power supply terminals and as input terminals. If the voltage drops below the minimum input voltage (60%), then the Relay will not operate due to an undervoltage.
  - 3. There is a risk of internal circuit breakage by high frequency waves. Don't use the product at the load side of inverter.

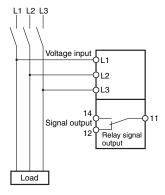

### K8AB-PH1

### Nomenclature

### Front

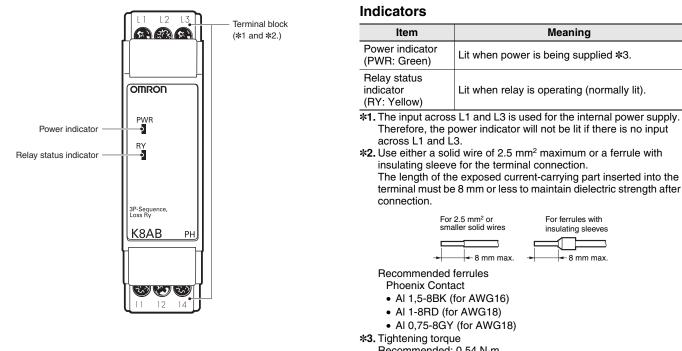


Recommended: 0.54 N·m Maximum: 0.59 N·m

# **Operation and Setting Methods**

### Connections

- Input Connect using L1, L2, and L3. Make sure the phase sequence is wired correctly. The Unit will not operate normally if the phase sequence is incorrect.
- 2. Outputs
- Terminals 11, 12, and 14 are output terminals for SPDT.

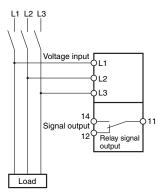


#### (Unit: mm)

# Dimensions

### Phase-sequence, Phase-loss Relays K8AB-PH1





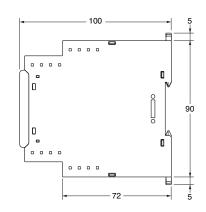

4

# **Safety Precautions**

### Precautions for Safe Use

Make sure to follow the instructions below to ensure safety.

- 1. Do not use or keep this product in the following environments.
  - Outdoors, or places subject to direct sunlight or wearing weather.
  - Places where dust, iron powder, or corrosive gases (in particular, sulfuric or ammonia gas) exist.
  - Places subject to static electricity or inductive noise.
  - Places where water or oil come in contact with the product.
- **2.** Make sure to install this product in the correct direction.
- 3. There is a remote risk of electric shock. Do not touch terminals while electricity is being supplied.
- 4. Make sure to thoroughly understand all instructions in the Instructions Manual before handling this product.
- Make sure to confirm terminal makings and polarity for correct wiring.
- Tighten terminal screws firmly using the following torque. Recommended tightening torque: 0.54 N·m Maximum tightening torque: 0.59 N·m max.
- Operating ambient temperature and humidity for this product must be within the indicated rating when using this product.
- 8. There is a remote risk of explosion. Do not use this product where flammable or explosive gas exists.
- 9. Make sure that no weight rests on the product after installation.
- **10.**To enable an operator to turn off this product easily, install switches or circuit breakers that conform to relevant requirements of IEC60947-1 and IEC60947-3, and label them appropriately.

### **Precautions for Correct Use**

#### **For Proper Use**

- Do not use the product in the following locations.
  Places subject to radiant heat from heat generating devices.
  Places subject to vibrations or physical shocks.
- Make sure to use setting values appropriate for the controlled object. Failure to do so can cause unintended operation, and may result in accident or corruption of the product.
- 3. Do not use thinner or similar solvent for cleaning. Use commercial alcohol.
- When discarding, properly dispose of the product as industrial waste.
- 5. Only use this product within a board whose structure allows no possibility for fire to escape.
- 6. This is a class A product. In residential areas it may cause radio interference, in which case the user may be required to take adequate measures to reduce interference.

#### About Installation

- 1. When wiring, use only recommended crimp terminals.
- Do not block areas around the product for proper dissipation of heat. (If you do not secure space for heat dissipation, life cycle of the product will be compromised.)
- 3. To avoid electrical shocks, make sure that power is not supplied to the product while wiring.
- To avoid electrical shocks, make sure that power is not supplied to the product when performing DIP switch settings.

#### **Noise Countermeasures**

- Do not install the product near devices generating strong high frequency waves or surges.
- 2. When using a noise filter, check the voltage and current and install it as close to the product as possible.
- 3. In order to prevent inductive noise, wire the lines connected to the product separately from power lines carrying high voltages or currents. Do not wire in parallel with or on the same cable as power lines.

Other measures for reducing noise include running lines along separate ducts and using shield lines.

# To avoid faulty operations, malfunctions, or failure, observe the following operating instructions.

- 1. When turning on the power, make sure to realize rated voltage within 1 second from the time of first supply of electricity.
- 2. Make sure to use power supply for operations, inputs, and transformer with the appropriate capacity and rated burden.
- Maintenance and handling of this product may only be performed by qualified personnel.
- Distortion ratio of input wave forms must be 30% or less. Use of this product with circuits that have large distortion in wave forms may result in unwanted operations.
- 5. Properly connect phase sequence.
- 6. The type K8AB-PH1 can only detect phase interruption when the interruption occurs on the side where power supply exists from the point of connection, and interruption on the loading side cannot be detected.
- 7. This product cannot be used for thyristor controls or inverters.
- 8. There is a risk of internal circuit breakage by high frequency waves. Don't use the product at the load side of inverter.

Q

Α

### **Questions and Answers**

#### **Checking Operation**


#### Phase Sequence

Switch the wiring, as shown by the dotted lines in the connection diagram, to reverse the phase sequence and check that the K8AB operates.

Phase Loss

Create a phase loss for any input phase and check that the K8AB operates.

#### **Connection Diagram**





Α

#### Can phase loss be detected on the load side?

In principle, phase loss cannot be detected on the load side because the K8AB-PH1 measures three-phase voltage to determine phase loss.



Α


#### Motor Load Phase Loss during Operation

Motor load phase loss can be detected during operation only when the motor has heavy load. Please use it with understanding the following

characteristics.

Normally, three-phase motors will continue to rotate even if one phase is open. The three-phase voltage will be induced at the motor terminals. The diagram shows voltage induction at the motor terminals when phase R has been lost with a load applied to a three-phase motor. The horizontal axis shows the motor load as a percentage of the rated load, and the vertical axis shows voltage as a percentage of the rated voltage. The lines in the graph show the voltage induced at the motor terminals for each load when phase loss occurs during operation. As the graph shows, voltage is induced at the motor terminals even if there is phase loss for a motor load, so K8AB-PH1 can detect phase loss for motor loads during operation with the condition of following graph. K8AB-PH1 can detect phase loss when startup without condition.

#### **Characteristic Curve Diagram**

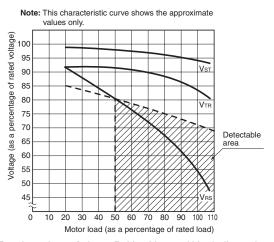

- **Note: 1.** For phase loss of phase R. VST, VTR, and VRS indicate the motor terminal voltage at phase loss.
  - 2. This graph shows that K8AB-PH1 can detect phase loss during operation when the motor load is more than 50%.
  - **3.** This is a general example and it doesn't guarantee the characteristics. Use K8AB-PH1 in view of the motor characteristics.

МЕМО

### Warranty and Application Considerations

#### **Read and Understand this Catalog**

Please read and understand this catalog before purchasing the products. Please consult your OMRON representative if you have any auestions or comments.

#### Warranty and Limitations of Liability

#### WARRANTY

OMRON's exclusive warranty is that the products are free from defects in materials and workmanship for a period of one year (or other period if specified) from date of sale by OMRON.

OMRON MAKES NO WARRANTY OR REPRESENTATION, EXPRESS OR IMPLIED, REGARDING NON-INFRINGEMENT, MERCHANTABILITY, OR FITNESS FOR PARTICULAR PURPOSE OF THE PRODUCTS. ANY BUYER OR USER ACKNOWLEDGES THAT THE BUYER OR USER ALONE HAS DETERMINED THAT THE PRODUCTS WILL SUITABLY MEET THE REQUIREMENTS OF THEIR INTENDED USE. OMRON DISCLAIMS ALL OTHER WARRANTIES, EXPRESS OR IMPLIED.

#### LIMITATIONS OF LIABILITY

OMRON SHALL NOT BE RESPONSIBLE FOR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, LOSS OF PROFITS, OR COMMERCIAL LOSS IN ANY WAY CONNECTED WITH THE PRODUCTS, WHETHER SUCH CLAIM IS BASED ON CONTRACT, WARRANTY, NEGLIGENCE, OR STRICT LIABILITY.

In no event shall the responsibility of OMRON for any act exceed the individual price of the product on which liability is asserted. IN NO EVENT SHALL OMRON BE RESPONSIBLE FOR WARRANTY, REPAIR, OR OTHER CLAIMS REGARDING THE PRODUCTS UNLESS OMRON'S ANALYSIS CONFIRMS THAT THE PRODUCTS WERE PROPERLY HANDLED, STORED, INSTALLED, AND MAINTAINED AND NOT SUBJECT TO CONTAMINATION, ABUSE, MISUSE, OR INAPPROPRIATE MODIFICATION OR REPAIR.

#### **Application Considerations**

#### SUITABILITY FOR USE

OMRON shall not be responsible for conformity with any standards, codes, or regulations that apply to the combination of products in the customer's application or use of the products.

Take all necessary steps to determine the suitability of the product for the systems, machines, and equipment with which it will be used. Know and observe all prohibitions of use applicable to this product.

NEVER USE THE PRODUCTS FOR AN APPLICATION INVOLVING SERIOUS RISK TO LIFE OR PROPERTY WITHOUT ENSURING THAT THE SYSTEM AS A WHOLE HAS BEEN DESIGNED TO ADDRESS THE RISKS, AND THAT THE OMRON PRODUCTS ARE PROPERLY RATED AND INSTALLED FOR THE INTENDED USE WITHIN THE OVERALL EQUIPMENT OR SYSTEM.

#### Disclaimers

#### **PERFORMANCE DATA**

Performance data given in this catalog is provided as a guide for the user in determining suitability and does not constitute a warranty. It may represent the result of OMRON's test conditions, and the users must correlate it to actual application requirements. Actual performance is subject to the OMRON Warranty and Limitations of Liability.

#### CHANGE IN SPECIFICATIONS

Product specifications and accessories may be changed at any time based on improvements and other reasons. Consult with your OMRON representative at any time to confirm actual specifications of purchased product.

#### DIMENSIONS AND WEIGHTS

Dimensions and weights are nominal and are not to be used for manufacturing purposes, even when tolerances are shown.

ALL DIMENSIONS SHOWN ARE IN MILLIMETERS. To convert millimeters into inches, multiply by 0.03937. To convert grams into ounces, multiply by 0.03527.

OMRON Corporation Industrial	Automation Company	Authorized Distributor:
Tokyo, JAPAN Contact: www.ia.om		
Regional Headquarters		
OMRON EUROPE B.V. Wegalaan 67-69-2132 JD Hoofddorp	OMRON ELECTRONICS LLC One Commerce Drive Schaumburg,	
The Netherlands Tel: (31)2356-81-300/Fax: (31)2356-81-388	IL 60173-5302 U.S.A. Tel: (1) 847-843-7900/Fax: (1) 847-843-7787	
OMRON ASIA PACIFIC PTE. LTD. No. 438A Alexandra Road # 05-05/08 (Lobby 2), Alexandra Technopark.	OMRON (CHINA) CO., LTD. Room 2211, Bank of China Tower, 200 Yin Cheng Zhong Road.	© OMRON Corporation 2010 All Rights Reserved. In the interest of product improvement, specifications are subject to change without notice.
Singapore 119967 Tel: (65) 6835-3011/Fax: (65) 6835-2711	PuDong New Area, Shanghai, 200120, China Tel: (86) 21-5037-2222/Fax: (86) 21-5037-2200	Printed in Japan        Cat. No. N145-E1-04      (0810)